

Nº 135 SERVICE BULLETIN



Joe Blackwell Director, Parts Sales & Technical Support Susan White Parts Sales Manager Patty Schraps Parts Stockroom Manager Chas Siddiqi Technical Support Engineer Jay Alfer Technical Support Doc. Administrator

TO: Parts & Service Managers

DATE: May 1, 2002

SUBJ: <u>OPTIONAL</u>



Ramp Butyrate Fix Kit (SPI: 502-5012-00)

Symptom:

Some **playfield shots** (from the flipper) into the *open Bank Door*, up the Center Ramp, tend to "loft" and hit the Center Ramp Entrance Gate Bracket *or* may lodge behind the *"Free Parking Sign."* If it hits the Gate Bracket, it causes the ball to be returned down the ramp, unable to complete the shot.

Explanation:

Locations with a *higher than normal* Line Voltage, may see lofting due to the *increased strength* of the Flippers. If you're experiencing the above symptom, the following *OPTIONAL Kit* may be purchased through your distributor.

Solution:

Attach the new *Clear Plastic (Butyrate) Piece* over the ramps as shown in the graphic below. This *Clear Plastic Piece* is included in the <u>OPTIONAL</u> MONOPOLY® RAMP BUTYRATE FIX KIT (SPI: 502-5012-00), along with this Service Bulletin 135 (SPI: 756-5012-00), #6 X 1/2" PTH A Screws (Qty. 2) (SPI: 237-5809-00) and Clear Plastic (Butyrate) Piece (Qty. 1) (SPI: 830-5995-00).

Note: This new piece will be included in any future orders of the Monopoly® Clear Plastic Set (830-5987-XX).



Step 1: Line up the new Clear Plastic (Butyrate) as shown and mark the 2 holes. Using a 3/32" Drill Bit, drill the 2 holes.

Step 2: Using the 2 screws, affix plastic.

Please phone or eMail with any questions or comments at the below numbers or address.



• 2020 Janice Ave • Melrose Park, IL 60160 • Tel 708-345-7700 (Option 1) • Toll-Free (USA/Canada) 1-800-542-5377 • Fax 708-345-7889 •