

## Nº 133



Joe Blackwell Director, Parts Sales & Technical Support Susan White Parts Sales Manager

Patty Schraps Parts Stockroom Manager

Chas Siddigi Technical Support Engineer Jay Alfer Technical Support Doc. Administrator

Parts & Service Managers

**DATE:** April 1, 2002

SUBJ: Monopoly® & Austin Powers CPU/Sound Board Modification

**Low Volume Setting Hum** 



and



## Symptom:

Undesirable hum and some audible distortion when the volume is set below Level 4 in the **Volume Menu** (accessed by pressing the "Red" Button first of the Service Switch Set on the Coin Door; Level Range is 0 - 31).



## **Explanation:**

Due to the large number of games being sold in the "Home Market," it was brought to our attention that **at very low** volume settings, there is an undesirable hum in the audio. To eliminate the hum (at very low volume), we are suggesting two (2) Resistor changes which will reduce the gain of the amplifier, however, will ensure the proper balance between the upper and lower channels are intact.


- Note 1: This will reduce the overall loudness of the game; you will need to set the Volume Level higher to achieve the same level you had before.
- This update on the CPU/Sound Board (SPI Part Number: 520-5136-16) is backwards Note 2: compatible, though you may have to TURN UP or DOWN the factory default volume setting depending on the game.

## Solution:

Have a qualified technician change **R110** to a **33K**  $\Omega$  1/4 Watt Resistor and change **R106** to a **10K**  $\Omega$  1/4 Watt Resistor.

Resistor Color Codes	
<b>33K</b> $Ω$ 1/4 Watt Resistor	ORG-ORG-ORG-GOLD
<b>10K</b> Ω 1/4 Watt Resistor	BRN-BLK-ORG-GOLD

View the following page for the locations of R106 & R110 on the CPU/Sound Board.

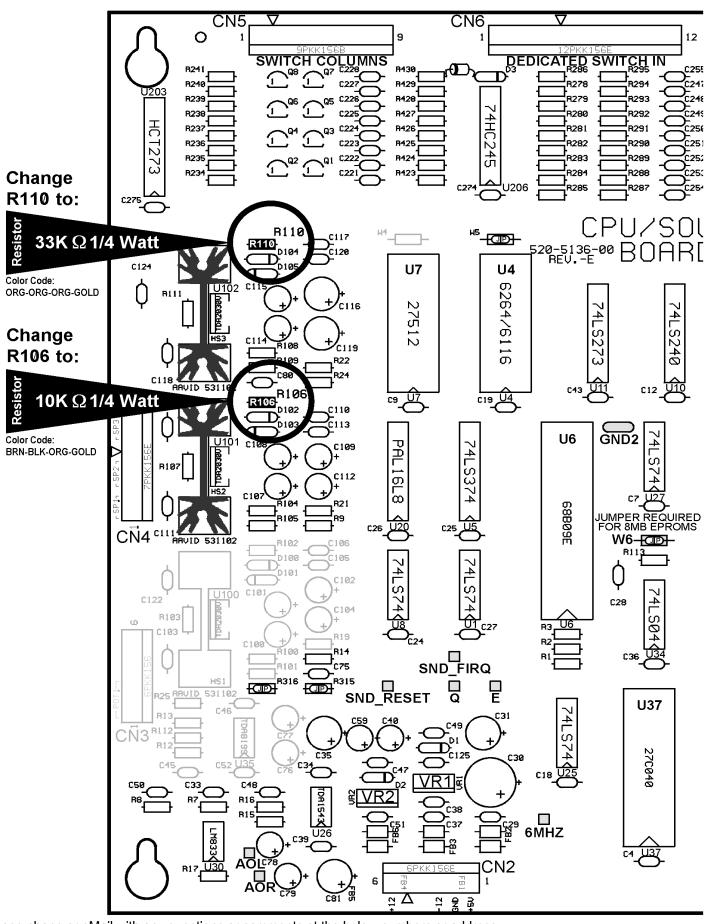

Please phone or eMail with any questions or comments at the below numbers or address.

<sup>• 2020</sup> Janice Ave • Melrose Park, IL 60160 • Tel 708-345-7700 (Option 1) • Toll-Free (USA/Canada) 1-800-542-5377 • Fax 708-345-7889 •